


HOW TO ORDER

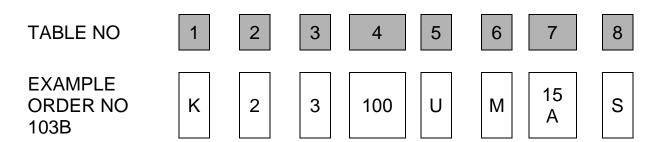

Example Order No. = Type 103B T/C-K ; 1/8" sheath diameter ; Inconel 600 sheath material ; 100mm long ; ungrounded measuring junction ; 1/2 N.P.T process connection ; aluminum connection head ; standard calibration.

Table 1. Sensor Type	
Single	Duplex
K	KK
J	JJ
Т	TT
E	EE
N	NN
P (For RTD)	PP

Table 2. Sheath Diameter "D"	
Order	Diameter
1	1/16"
2	1/8"
3	3/16"
4	1⁄4"
6	3/8"
7	Other

Table 3. Sheath Material	
Order	Description
3	Inconel 600
4	310 ST.ST.
8	316 ST.ST.
9	304 ST.ST.

Table 4. Dimension "U"	
Insert "U" in MM (3 digit)	

Table 5A. Measuring	
Junction (for T/C only)	
Order	Description
G	Grounded
U	Ungrounded
E	Exposed

Table 5B. Wiring System (for RTD'S only)	
Order	Description
2	2-wire system
3	3-wire system
4	4-wire system

Table 6. Process Connection	
Order	Description
М	1/2" N.P.T
R	1/2" B.S.P
Q	3/4" N.P.T
V	3/4" B.S.P
0	Other

Table 8. Sensor Accuracy	
Order	Description
S	Standard
SC	Special
	Calibration

Table 7. Connection Head	
Order	Description
15A	Cast aluminum epoxy coated screwed cover
16B	Aluminum type "B"
17M	Cast aluminum mini size
18P	Reinforced Polypropilene
19E	EX-proof Cast aluminum epoxy coated
201	Cast iron epoxy coated screwed cover
21GN	Nylon + Glass Fiber
22GP	Glass Reinforced Polyamide
23PH	Phenyl Polyoxide